

ASSEMBLIES AFFECTED				PROCUREMENT		WORK IN PROCESS			FIELD		
#	PART #	DESCRIPTION	REV.	ON ORDER	NEW ORDER	STK.	WIP	FGI	RETRO	SPARES	RMA's
1	02-270335-02	Video Input Module	17	8	8	9	9	9	9	9	9
2	02-270335-02	Video Input Module	18	7	7	7	7	7	7	7	7
3	02-270335-04	Video Input Module, Madrigal	6	8	8	9	9	9	9	9	9
4	02-270335-04	Video Input Module, Madrigal	7	7	7	7	7	7	7	7	7
5	02-270335-05	Video Input Module, 8520	2	8	8	9	9	9	9	9	9
6	02-270335-05	Video Input Module, 8520	3	7	7	7	7	7	7	7	7
7											
8											

1 Use as is 2 Rework in house 3 Rework outside 4 Rework units in the field 5 Documentation change only

6 Send to MRB for disposition 7 New release 8 Cancel orders 9 As Required 10

PROBLEM DEFINITION

Faint vertical white line near right edge of image with dark images viewed in very dark enviroments.

CHANGE AS FOLLOWS

Add 1.5M 1/8W (20151) from U15-2 to U15-11, U15-6 to U15-11,
and U15-9 to U15-11.

**CONTROLLED
DOCUMENT**
MUST BE IN RED INK TO BE VALID

